
Element Code: 3.B.1 **Description:** Newel Post Capital

Element Type: Metal Substrate

Location: Staircase

Color Chip:

Color Notes: Munsell Color Notation 10YR 8/4
Medium Yellow Gray Brown

Findings: Found 4 layers of pigmented paint

Test/Analysis: 1st Coat – Black Primer
 (ground) 1st Pigmented Layer – 10YR 8/4
 Medium Yellow Gray Brown
 2nd Pigmented Layer – Gold Metallic Powder

Element Code: 3.B.2 **Description:** Newel Post Abacus

Element Type: Metal Substrate


Location: Staircase

Color Chip:

Color Notes: Munsell Color Notation 7.5YR 7/4
Medium Light Brown

Findings: Found 5 layers of pigmented paint

Test/Analysis: 1st Coat – Black Primer
 1st Pigmented Layer – 7.5YR 7/4
 Medium Light Brown

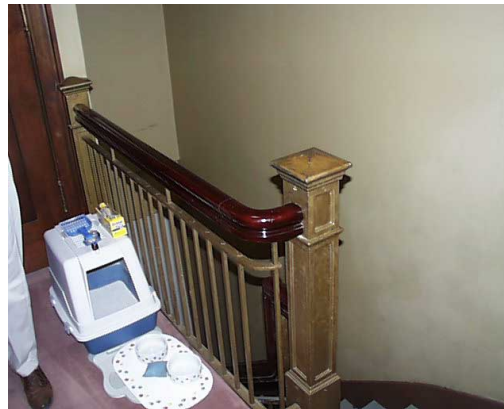

Element Code: <u>3.B.4</u>	Description: Newel Post Architrave
--	--

Element Type: Metal Substrate


Location: Staircase

Color Chip:

Color Notes: Munsell Color Notation 7.5YR 7/4
Medium Light Brown
Gold Metallic Powder

Findings: Found 5 layers of pigmented paint

Test/Analysis: 1st Coat – Black Primer
(ground) 1st Pigmented Layer – 7.5YR 7/4
Medium Light Brown
2nd Pigmented Layer – Gold Metallic Powder

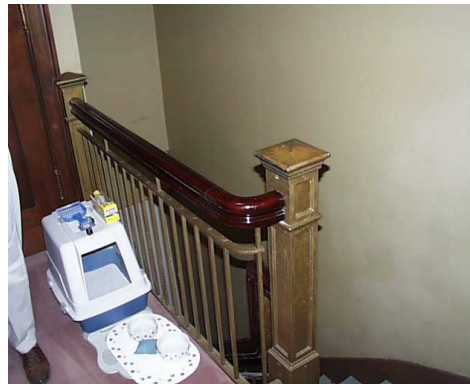

Element Code: 3.B.5 **Description:** Shaft of Newel Post

Element Type: Metal Substrate

Location: Staircase

Color Chip:

Color Notes: Gold Metallic Powder

Findings: Found 5 layers of pigmented paint

Test/Analysis: 1st Coat – Black Primer
 1st Pigmented Layer – Gold Metallic Powder

Element Code: 3.B.6 **Description:** Base of Newel Post

Element Type: Metal Substrate


Location: Staircase

Color Chip:

Color Notes: Munsell Color Notation 10YR 7.5/2
 Light Gray Brown
 Gold Metallic Powder

Findings: Found 4 layers of pigmented paint

Test/Analysis: 1st Coat – Black Primer
 (ground) 1st Pigmented Layer – 10YR 7.5/2
 Light Gray Brown
 2nd Pigmented Layer – Gold Metallic Powder

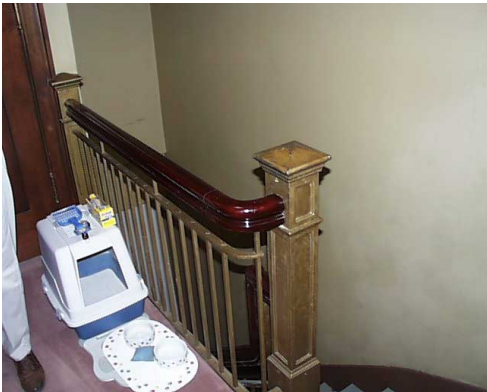

Element Code: 3.B.7 **Description:** Base Flat Section Newel Post

Element Type: Metal Substrate

Location: Staircase

Color Chip:

Color Notes: Gold Metallic Powder

Findings: Found 3 layers of pigmented paint

Test/Analysis: 1st Coat – Black Primer
 1st Pigmented Layer – Gold Metallic Powder

Element Code: 3.B.8 **Description:** Lower Base

Element Type: Metal Substrate


Location: Staircase

Color Chip:

Color Notes: Munsell Color Notation 10YR 7.5/2
 Light Gray Brown

Findings: Found 4 layers of pigmented paint

Test/Analysis: 1st Coat – Black Primer
 (ground) 1st Pigmented Layer – 10YR 7.5/2
 Light Gray Brown
 2nd Pigmented Layer – Gold Metallic Powder

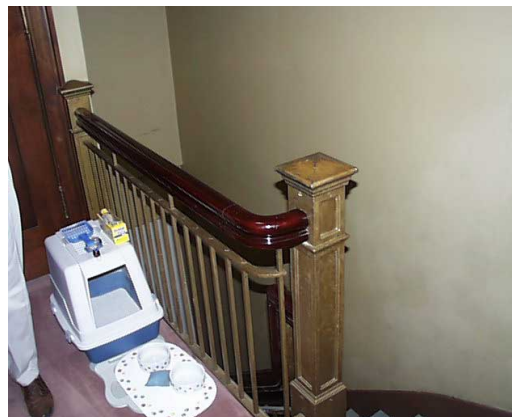

Element Code: 3.B.9 **Description:** Upper Band

Element Type: Metal Substrate

Location: Staircase

Color Chip:

Color Notes: Munsell Color Notation 10YR 7.5/2
Light Gray Brown

Findings: Found 5 layers of pigmented paint

Test/Analysis: 1st Coat – Black Primer
1st Pigmented layer – 10YR 7.5/2
Light Gray Brown

Element Code: 3.B.10 **Description:** Railing

Element Type: Metal Substrate


Location: Staircase

Color Chip:

Color Notes: Munsell Color Notation 10YR 7.5/2
Light Gray Brown

Findings: Found 5 layers of pigmented paint

Test/Analysis: 1st Coat – Black Primer
1st Pigmented Layer – 10YR 7.5/2
Light Gray Brown

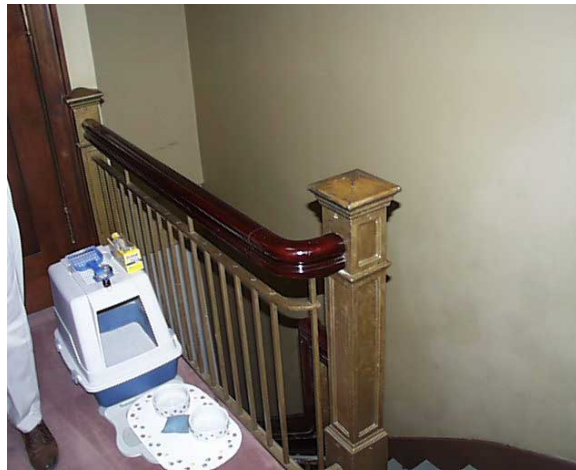

Element Code: 3.B.11 **Description:** Risers

Element Type: Metal Substrate

Location: Staircase

Color Chip:

Color Notes: Gold Metallic Powder

Findings: Found 3 layers of pigmented paint

Test/Analysis: 1st Coat – Black Primer
 1st Pigmented Layer – Gold Metallic Powder



Element Code: 3.B.12 **Description:** Baseboards

Element Type: Metal Substrate

Location: Staircase

Color Chip:

Color Notes: 10YR 9/1 Gray Yellow White

Findings: Found 8 layers of pigmented paint

Test/Analysis: 1st Coat – Red Oxide Primer
 1st Pigmented Layer – 10YR 9/1
 Gray Yellow White



Element Code: 3.B.13 **Description:** Rosette On Stringer

Element Type: Metal Substrate

Location: Staircase

Color Chip:

Color Notes: Gold Metallic Powder

Findings: Found 3 layers of pigmented paint

Test/Analysis: 1st Coat – Black Primer
 1st Pigmented Layer – Gold Metallic Powder



Element Code: 3.B.14 **Description:** Flat Field of String Course

Element Type: Metal Substrate

Location: Staircase

Color Chip:

Color Notes: Gold Metallic Powder

Findings: Found 3 layers of pigmented paint

Test/Analysis: 1st Coat – Black Primer
 1st Pigmented Layer – Gold Metallic Powder



Element Code: 3.H.1 **Description:** Wall

Element Type: Synthetic Linen

Location: House of Representatives

Color Chip:

Color Notes: Munsell Color Notation 2.5Y 8.5/2
Medium Yellow Gray

Findings: Found 6 layers of pigmented paint

Test/Analysis: 1st Coat – Orange Shellac
1st Pigmented Layer – 2.5Y 8.5/2
Medium Yellow Gray



Element Code: 3.H.2 **Description:** ¼” Flat Band On Wall

Element Type: Synthetic Canvas

Location: House of Representatives

Color Chip:

Color Notes: Munsell Color Notation 10Y 6/4
Medium Dark Terra Verte
Aluminum Powder

Findings: Found 4 layers of pigmented paint

Test/Analysis: 1st Coat – Orange Shellac
(ground) 1st Pigmented Layer – 10Y 6/4
Medium Dark Terra Verte
2nd Pigmented Layer – Aluminum Powder



Element Code: 3.H.3 **Description:** 1 ½” Flat Band
On Inner Wall

Element Type: Plaster Substrate

Location: House of Representatives

Color Chips:

Color Notes: Munsell Color Notation 2.5Y 6/4
Gray Yellow Green

Findings: Found 3 layers of pigmented paint

Test/Analysis: 1st Coat – No Visible Primer
1st Pigmented Layer – 2.5Y 6/4
Gray Yellow Green

Element Code: 3.H.4 **Description:** 1” Leaf & Dart

Element Type: Plaster Substrate

Location: House of Representatives

Color Chip:

Color Notes: Munsell Color Notation 10YR 7/8
Yellow Ochre
Gold Leaf

Findings: Found 2 layers of pigmented paint

Test/Analysis: 1st Coat – White Primer
(ground) 1st Pigmented Layer – 10YR 7/8
Yellow Ochre
2nd Pigmented Layer – Gold Leaf



Element Code: 3.H.5 **Description:** Middle Flat Field of Wall

Element Type: Canvas

Location: House of Representatives

Color Chip:

Color Notes: Gold Metallic Powder

Findings: Found 8 layers of pigmented paint

Test/Analysis: 1st Coat – No Visible Primer
1st Pigmented Layer – Gold Metallic Powder

Element Code: 3.H.6 **Description:** 3” Leaf Ornamental

Element Type: Plaster Substrate

Location: House of Representatives

Color Chip:

Color Notes: Munsell Color Notation 10YR 7/8
Yellow Ochre
Gold Leaf

Findings: Found 4 layers of pigmented paint

Test/Analysis: 1st Coat – Orange Shellac
(ground) 1st Pigmented Layer – 10YR 7/8
Yellow Ochre
2nd Pigmented Layer – Gold Leaf



Element Code: 3.H.7 **Description:** 3” Leaf Ornament Highlighted Area

Element Type: Plaster Substrate

Location: House of Representatives

Color Chip:

Color Notes: Munsell Color Notation 10YR 7/8
Yellow Ochre Gold Metallic Powder

Findings: Found 5 layers of pigmented paint

Test/Analysis: 1st Coat – Orange Shellac (ground) 1st Pigmented Layer – 10YR 7/8
Yellow Ochre 2nd Pigmented Layer – Gold Metallic Powder



Element Code: 3.H.9 **Description:** Outer Flat Field

Element Type: Light Open Weave Canvas

Location: House of Representatives

Color Chip:

Color Notes: Munsell Color Notation 10YR 8.5/3.5
Light Gray Brown Yellow

Findings: Found 6 layers of pigmented paint

Test/Analysis: 1st Coat – White Primer
(ground) 1st Pigmented Layer – 10YR 8.5/3.5
Light Gray Brown Yellow

Element Code: 3.H.10 **Description:** Medallion Center

Element Type: Plaster Substrate

Location: House of Representatives

Color Chip:

Color Notes: Munsell color Notation 10YR 7/8
Yellow Ochre
Gold Leaf

Findings: Found 4 layers of pigmented paint

Test/Analysis: 1st Coat – Orange Shellac
(ground) 1st Pigmented Layer – 10YR 7/8
Yellow Ochre
2nd Pigmented Layer – Gold Leaf



Element Code: 3.H.11 **Description:** Medallion Petals

Element Type: Plaster Substrate

Location: House of Representatives

Color Chip:

Color Notes: Gold Metallic Powder

Findings: Found 3 layers of pigmented paint

Test/Analysis: 1st Coat – Orange Shellac
1st Pigmented Layer – Gold Metallic Powder



Element Code: 3.H.39 **Description:** 1 ½” Band of Crown Molding of Cornice

Element Type: Plaster Substrate

Location: House of Representatives

Color Chip:

Color Notes: Munsell Color Notation 5Y 9/2.5
Gray Green Yellow

Findings: Found 3 layers of pigmented paint

Test/Analysis: 1st Coat – No Visible Primer
1st Pigmented Layer – 5Y 9/2.5
Gray Green Yellow



Element Code: 3.H.40 **Description:** Crown Molding
Of Cornice

Element Type: Plaster Substrate

Location: House of Representatives

Color Chip:

Color Notes: Munsell Color Notation 10YR 7/4
Medium Dark Gray Yellow Brown
Gold Metallic Powder

Findings: Found 4 layers of pigmented paint

Test/Analysis: 1st Coat – White Primer
1st Pigmented Layer – 10YR 7/4
Medium Dark Gray Yellow Brown

Element Code: 3.H.42 **Description:** Bead & Reel
Of Cornice

Element Type: Plaster Substrate

Location: House of Representatives

Color Chip:

Color Notes: Gold Metallic Powder

Findings: Found 5 layers of pigmented paint

Test/Analysis: 1st Coat – No Visible Primer
1st Pigmented Layer – Gold Metallic Powder



Element Code: 3.H.52 **Description:** Console of
Entablature of Cornice

Element Type: Plaster Substrate

Location: House of Representatives

Color Chip:

Color Notes: Munsell Color Notation 5Y 8.5/3
Medium Gray Green Yellow
Gold Metallic Powder

Findings: Found 4 layers of pigmented paint

Test/Analysis: 1st Coat – White Primer
(ground) 1st Pigmented Layer – 5Y 8.5/3
Medium Gray Green Yellow
2nd Pigmented Layer – Gold Metallic Powder

Element Code: 3.H.57 **Description:** Dart of
Egg & Dart of Cornice

Element Type: Plaster Substrate

Location: House of Representatives

Color Chip:

Color Notes: Munsell Color Notation 10YR 9/2
Brown Yellow White

Findings: Found 5 layers of pigmented paint

Test/Analysis: 1st Coat – Orange Shellac
(ground) 1st Pigmented Layer – 10YR 9/2
Brown Yellow White



Element Code: 3.H.58 **Description:** Egg
Of Egg & Dart of Cornice

Element Type: Plaster Substrate

Location: House of Representatives

Color Chip:

Color Notes: Munsell Color Notation 10YR 9/2
Brown Yellow White
Gold Metallic Powder

Findings: Found 5 layers of pigmented paint

Test/Analysis: 1st Coat – Orange Shellac
1st Pigmented Layer – 10YR 9/2
Brown Yellow White
2nd Pigmented Layer – Gold Metallic Powder

Element Code: 3.H.60 **Description:** Dentil
Molding of Cornice

Element Type: Plaster Substrate

Location: House of Representatives

Color Chip:

Color Notes: Munsell Color Notation 5Y 9/0.5
Pale Yellow Gray
Gold Metallic Powder

Findings: Found 4 layers of pigmented paint

Test/Analysis: 1st Coat – Orange Shellac
(ground) 1st Pigmented Layer – 5Y 9/0.5
Pale Yellow Gray
2nd Pigmented Layer Gold Metallic Powder



Element Code: 3.H.61 **Description:** Trim Molding
Under Dentil

Element Type: Plaster Substrate

Location: Mezzanine House of Representatives

Color Chip:

Color Notes: Munsell Color Notation 10YR 8.5/1.5
Light Gray Brown White
Gold Metallic Powder

Findings: Found 4 layers of pigmented paint

Test/Analysis: 1st Coat – White Primer
(ground) 1st Pigmented Layer – 10YR 8.5/1.5
Light Gray Brown White
2nd Pigmented Layer – Gold Metallic Powder



Element Code: 4.B.1 **Description:** Rosette on
Upper Frieze

Element Type: Plaster Substrate

Location: Corridor or Supreme Court

Color Chip:

Color Notes: Munsell Color Notation 5Y 8.5/0.5
Light Brown Gray

Findings: Found 5 layers of pigmented paint

Test/Analysis: 1st Coat – Orange Shellac
1st Pigmented Layer – 5Y 8.5/0.5
Light Brown Gray



Element Code: 4.E.1 **Description:** Dentil Molding

Element Type: Plaster Substrate

Location: Mezzanine of Senate

Color Chip:

Color Notes: Gold Metallic Powder

Findings: Found 4 layers of pigmented paint

Test/Analysis: 1st Coat – Orange Shellac
 1st Pigmented Layer – Gold Metallic Powder

Element Code: 4.E.2 **Description:** Bead & Reel

Element Type: Plaster Substrate

Location: Mezzanine of Senate

Color Chip:

Color Notes: Munsell Color Notation 5Y 8.5/0.5
 Yellow White Gray

Findings: Found 5 layers of pigmented paint

Test/Analysis: 1st Coat – White Primer
 1st Pigmented Layer – 5Y 8.5/0.5
 Yellow White Gray



Element Code: 4.E.3 **Description:** Egg & Dart

Element Type: Plaster Substrate

Location: Mezzanine of Senate

Color Chip:

Color Notes: Munsell Color Notation 5Y 9/1
 Gray Green White
 Gold Metallic Powder

Findings: Found 8 layers of pigmented paint

Test/Analysis: 1st Coat – White Primer
 (ground) 1st Pigmented layer – 5Y 9/1
 Gray Green White
 2nd Pigmented Layer – Gold Metallic Powder

Element Code: 4.E.4 **Description:** Cornucopia

Element Type: Plaster Substrate


Location: Mezzanine of Senate

Color Chip:

Color Notes: Munsell Color Notation 10YR 9/2
 Brown Yellow White

Findings: Found 7 layers of pigmented paint

Test/Analysis: 1st Coat – Orange Shellac
 1st Pigmented layer – 10YR 9/2
 Brown Yellow White

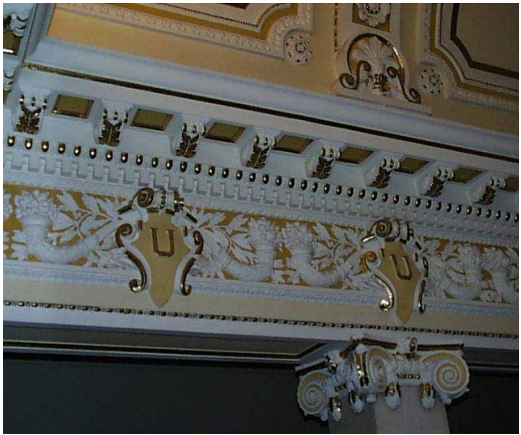

Element Code: 4.E.5 **Description:** Medallion Center

Element Type: Plaster Substrate

Location: Mezzanine of Senate

Color Chip:

Color Notes: Munsell Color Notation 10YR 9/2
Brown Yellow White
Gold Metallic Powder

Findings: Found 2 layers of pigmented paint

Test/Analysis: 1st Coat – White Primer
 (ground) 1st Pigmented Layer – 10YR 9/2
 Brown Yellow White
 2nd Pigmented Layer – Gold Metallic Powder

Element Code: 4.E.6 **Description:** Leaf & Dart Under Cornucopia

Element Type: Plaster Substrate

Location: Mezzanine of Senate

Color Chip:

Color Notes: Munsell Color Notation 10YR 9/1
Gray Yellow White
Gold Metallic Powder

Findings: Found 5 layers of pigmented paint

Test/Analysis: 1st Coat – White Primer
 (ground) 1st Pigmented Layer – 10YR 9/1
 Gray Yellow White
 Gold Metallic Powder



Element Code: <u>4.E.8</u>	Description: Ionic Detail Column Capital
-----------------------------------	--

Element Type: Plaster Substrate

Location: Mezzanine of Senate

Color Chip:

Color Notes: Gold Metallic Powder

Findings: Found 4 layers of pigmented paint

Test/Analysis: 1st Coat – Orange Shellac
1st Pigmented Layer – Gold Metallic Powder



Element Code: 4.E.9 **Description:** Beam Underside

Element Type: Plaster Substrate

Location: Mezzanine of Senate

Color Chip:

Color Notes: Munsell Color Notation 10YR 9/4
Medium Gray Brown Yellow

Findings: Found 4 layers of pigmented paint

Test/Analysis: 1st Coat – White Primer
1st Pigmented Layer – 10YR 9/4
Medium Gray Brown Yellow



Element Code: 4.J.3 **Description:** Crown Molding

Element Type: Plaster Substrate

Location: Mezzanine of House of Representatives

Color Chip:

Color Notes: Munsell Color Notes 10YR 7.5/2
Light Gray Brown

Findings: Found 6 layers of pigmented paint

Test/Analysis: 1st Coat – White Primer
1st Pigmented Layer – 10YR 7.5/2
Light Gray Brown



PAGE XIX.X52



Element Code: 4.J.8 **Description:** Wall

Element Type: Plaster Skim Coat

Location: Mezzanine of House of Representatives

Color Chip:

Color Notes: Munsell Color Notation 10YR 9/2
Brown Yellow White

Findings: Found 2 layer of pigmented paint

Test/Analysis: 1st Coat – White Primer
1st Pigmented Layer – 10YR 9/2
Brown Yellow White

Element Code: 4.J.9 **Description:** Wall Above
Stencil Pattern

Element Type: Plaster Substrate

Location: Mezzanine of House of Representatives

Color Chip:

Color Notes: Munsell Color Notations 5GY 7/2.5
Medium Gray Yellow Green

Findings: Found 1 layer of pigmented paint

Test/Analysis: 1st Coat – White Primer
1st Pigmented Layer – 5GY 7/2.5
Medium Gray Yellow Green



Element Code: 4.J.10 **Description:** Background
of Stencil

Element Type: Plaster Skim Coat

Location: Mezzanine of House of Representatives

Color Chip:

Color Notes: Munsell Color Notation 10YR 9/2
Brown Yellow White
Gold Leaf

Findings: Found 2 layers of pigmented paint

Test/Analysis: 1st Coat – White Primer
(ground) 1st Pigmented Layer – 10YR 9/2
Brown Yellow White
2nd Pigmented Layer – Gold Leaf

Element Code: 4.J.11 **Description:** Stencil Pattern

Element Type: Plaster Substrate

Location: Mezzanine of House of Representatives

Color Chip:

Color Notes: Munsell color Notation 10YR 9/2
Brown Yellow White

Findings: Found 2 layers of pigmented paint

Test/Analysis: 1st Coat – Gesso
1st Pigmented Layer – 10YR 9/2
Brown Yellow White



Element Code: 4.J.12 **Description:** 1 1/2" Inner Band

Element Type: Synthetic Canvas

Location: Mezzanine of House of Representatives

Color Chip:

Color Notes: Munsell Color Notation 10YR 8.5/2.5
Medium Gray Yellow Brown

Findings: Found 3 layers of pigmented paint

Test/Analysis: 1st Coat – White Primer
1st Pigmented Layer – 10YR 8.5/2.5
Medium Gray Yellow Brown

Element Code: 4.J.13 **Description:** 1/2" Inner Band

Element type: Synthetic Canvas

Location: Mezzanine of House of Representatives

Color Chip:

Color Notes: Munsell Color Notation 10YR 9/2
Brown Yellow White

Findings: Found 2 layers of pigmented paint

Test/Analysis: 1st Coat – White Primer
1st Pigmented Layer – 10YR 9/2
Brown Yellow White



Element Code: 4.J.14 **Description:** Crown Molding

Element Type: Plaster Substrate

Location: Mezzanine of House of Representatives

Color Chip:

Color Notes: Munsell Color Notation 10YR 8/2.5
Pale Yellow Brown

Findings: Found 3 layers of pigmented paint

Test/Analysis: 1st Coat – Orange Shellac
(ground) 1st Pigmented Layer – 10YR 8/2.5
Pale Yellow Brown
2nd Pigmented Layer – Gold Metallic Powder

Element Code: 4.J.15 **Description:** Band

Element Type: Plaster Substrate


Location: Mezzanine of House of Representatives

Color Chip:

Color Notes: Munsell Color Notation 10YR 7/8
Yellow Ochre

Findings: Found 4 layers of pigmented paint

Test/Analysis: 1st Coat – Orange Shellac
(ground) 1st Pigmented Layer – 10YR 7/8
Yellow Ochre
2nd Pigmented Layer – Gold Leaf

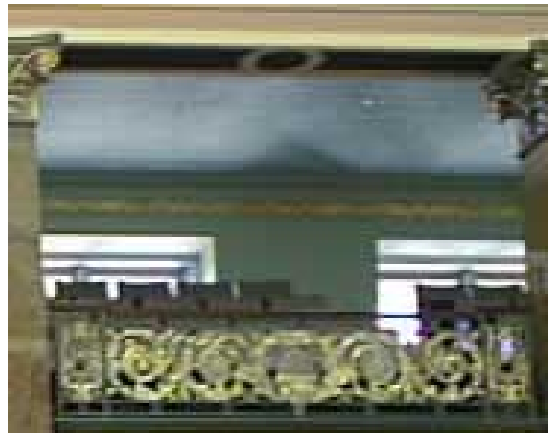

Element Code: 4.J.17 **Description:** Column Capital
Hair Detail

Element Type: Plaster Substrate

Location: Mezzanine of House of Representatives

Color Chip:

Color Notes: Munsell Color Notation 10YR 7/8
Yellow Ochre
Gold Leaf

Findings: Found 4 layers of pigmented paint

Test/Analysis: 1st Coat – Orange Shellac
(ground) 1st Pigmented Layer – 10YR 7/8
Yellow Ochre
2nd Pigmented Layer – Gold Leaf

Element Code: 4.J.20 **Description:** Face on
Column Capital

Element Type: Plaster Substrate

Location: Mezzanine of House of Representatives

Color Chip:

Color Notes: Munsell color Notation 10YR 8/2.5
Pale Yellow Brown

Findings: Found 4 layers of pigmented paint

Test/Analysis: 1st Coat – Orange Shellac
1st Pigmented Layer – 10YR 8/2.5
Pale Yellow Brown
2nd Pigmented Layer – Gold Leaf



Element Code: 4.J.22 **Description:** 2" Horizontal Band
Column Capital

Element Type: Plaster Substrate

Location: Mezzanine of House of Representatives

Color Chip:

Color Notes: Gold Leaf

Findings: Found 3 layers of pigmented paint

Test/Analysis: 1st Coat – Orange Shellac
1st Pigmented Layer – Gold Leaf

Element Code: 4.J.23 **Description:** Acanthus Leaf
Under Face of Column Capital

Element Type: Plaster Substrate

Location: Mezzanine of House of Representatives

Color Chip:

Color Notes: Munsell Color Notation 10YR 7/8
Yellow Ochre
Gold Leaf

Findings: Found 5 layers of pigmented paint

Test/Analysis: 1st Coat – Orange Shellac
(ground) 1st Pigmented Layer- 10YR 7/8
Yellow Ochre
2nd Pigmented Layer - Gold Leaf



Element Code: 4.J.24 **Description:** Scroll of
Column Capital

Element Type: Plaster Substrate

Location: Mezzanine of House of Representatives

Color Chip:

Color Notes: Munsell Color Notation 10YR 7/8
Yellow Ochre
Gold Leaf

Findings: Found 4 layers of pigmented paint

Test/Analysis: 1st Coat – Orange Shellac
(ground) 1st Pigmented Layer – 10YR 7/8
Yellow Ochre
Gold Leaf

Element Code: 4.J.26 **Description:** Fluted Detail
of Column Capital

Element Type: Plaster Substrate

Location: Mezzanine of House of Representatives

Color Chip:

Color Notes: Munsell Color Notation 10YR 7/8
Yellow Ochre
Gold Metallic Powder

Findings: Found 4 layers of pigmented paint

Test/Analysis: 1st Coat – Orange Shellac
(ground) 1st Pigmented Layer – 10YR 7/8
Yellow Ochre
2nd Pigmented Layer - Gold Metallic Powder



Element Code: 4.J.27 **Description:** Leaf Detail

Element Type: Plaster Substrate

Location: Mezzanine of House of Representatives

Color Chip:

Color Notes: Munsell Color Notation 10YR 8/4
Medium Yellow Gray Brown
Gold Leaf

Findings: Found 6 layers of pigmented paint

Test/Analysis: 1st Coat – Orange Shellac
(ground) 1st Pigmented Layer – 10YR 8/4
Medium Yellow Gray Brown
2nd Pigmented Layer – Gold Leaf

Element Code: 4.J.28 **Description:** Acanthus Leaf

Element Type: Plaster Substrate

Location: Mezzanine of House of Representatives

Color Chip:

Color Notes: Munsell Color Notation 10YR 7/8
Yellow Ochre
Gold Metallic Powder

Findings: Found 3 layers of pigmented paint

Test/Analysis: 1st Coat - Orange Shellac
(ground) 1st Pigmented Layer – 10YR 7/8
Yellow Ochre
2nd Pigmented Layer – Gold Metallic Powder



Element Code: 4.J.32 **Description:** Metal Railing

Element Type: Metal Substrate
Location: Mezzanine of House of Representatives

Color Chip:

Color Notes: Gold Leaf

Findings: Found 4 layers of pigmented paint

Test/Analysis: 1st Coat – Red Oxide Primer
 1st Pigmented Layer – Gold Leaf

Element Code: 4.J.33 **Description:** Baseboard


Element Type: Plaster Substrate
Location: Mezzanine of House of Representatives

Color Chip:

Color Notes: Munsell Color Notation 5GY 7/2.5 Pale Yellow Green

Findings: Found 5 layers of pigmented paint

Test/Analysis: 1st Coat – White Primer
 1st Pigmented Layer – 5GY 7/2.5
 Pale Yellow Green

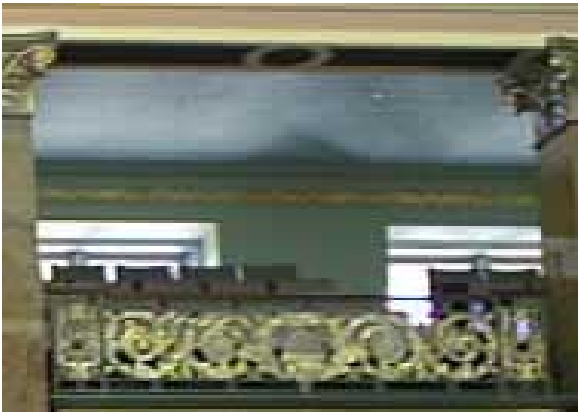

Element Code: 4.J.35 **Description:** Underside of Beam

Element Type: Plaster Substrate

Location: Mezzanine of House of Representatives

Color Chip:

Color Notes: Munsell Color Notation 10YR 7/4
Medium Dark Gray Yellow Brown

Findings: Found 2 layers of pigmented paint

Test/Analysis: 1st Coat – White Primer
1st Pigmented Layer – 10YR 7/4
Medium Dark Gray Yellow Brown

Element Code: 4.J.36 **Description:** Trim Molding

Element Type: Plaster Substrate


Location: Mezzanine of House of Representatives

Color Chip:

Color Notes: Munsell Color Notation 10YR 7.5/2
Light Gray Brown

Findings: Found 7 layers of pigmented paint

Test/Analysis: 1st Coat – No Visible Primer
(ground) 1st Pigmented Layer – 10YR 7.5/2
Light Gray Brown
2nd Pigmented Layer – Gold Metallic Powder

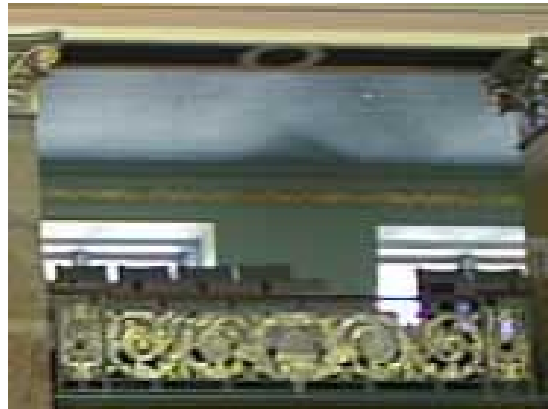

Element Code: 4.J.37 **Description:** Rectangular Flat Field
Of Beams

Element Type: Canvas on Plaster

Location: Mezzanine of House of Representatives

Color Chip:

Color Notes: Munsell Color Notation 10YR 7/4
Medium Dark Gray Brown

Findings: Found 3 layers of pigmented paint

Test/Analysis: 1st Coat – No Visible Primer
1st Pigmented Layer – 10YR 7/4
Medium Dark Gray Brown

Element Code: 4.J.38 **Description:** Inner
Section of Circle Detail
Underside of Beam

Element Type: Canvas on Plaster

Location: Mezzanine of House of Representatives

Color Chip:

Color Notes: Munsell Color Notation 10YR 7/4
Medium Dark Gray Brown

Findings: Found 4 layers of pigmented paint

Test/Analysis: 1st Coat – White Primer
1st Pigmented Layer – 10YR 7/4
Medium Dark Gray Brown

